7/8" EIA Positive Stop™ Connectors

for HELIAX® Coaxial Cable

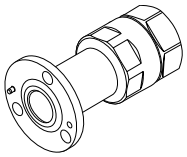

AL5E78-PS

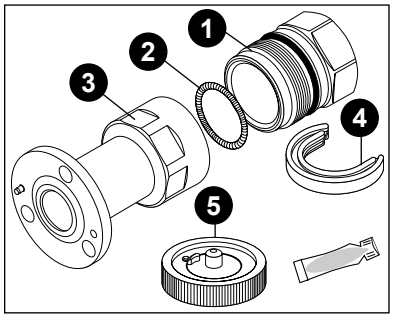



CPT-78U

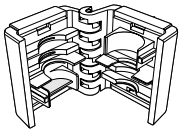

MCPT-78

Cuts per Blade	Blade Part Number
20 (min.)	MCPT-BK5

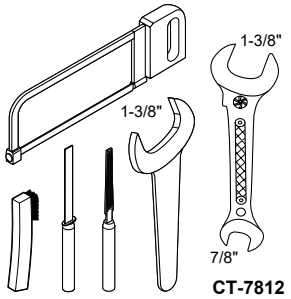

CT-7812

1a

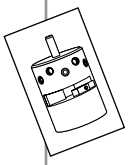

Trim cable jacket
Recortar la envuelta del cable
Coupez la gaine du câble
Kabelmantel abziehen
Retire a capa do cabo
Rifilare la guaina del cavo.
切整電纜外皮

Note: The automated drill tool can't be used when install connector for AL5 cable.

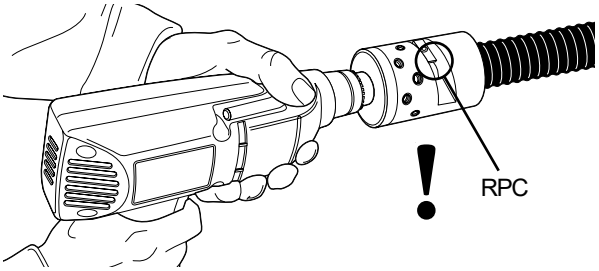

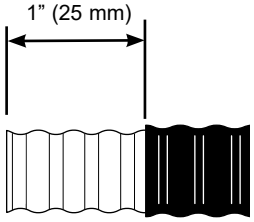

6

1

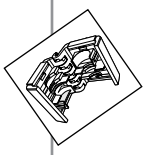

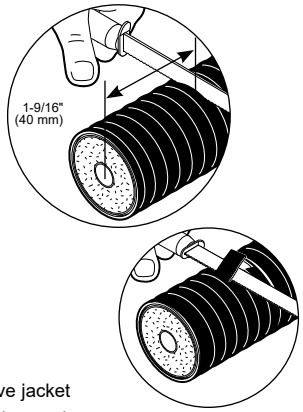

Remove jacket
Retire la envolvente
Retirez la gaine
Mantel abnehmen
Remova o revestimento
剥下护皮

2

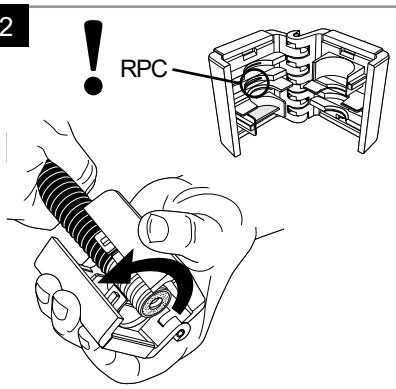

Gently spin approx. 12 times
Gire suavemente unas 12 vueltas
Tournez environ 12 fois avec précaution
Vorsichtig um ca. 12 Umdrehungen drehen
Gire cuidadosamente cerca de 12 voltas
轻轻旋转 12 次左右

3

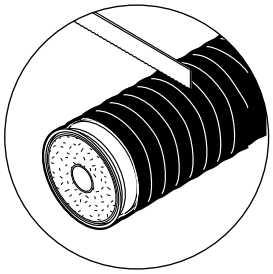

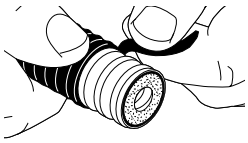

Remove jacket
Retire la envolvente
Retirez la gaine
Mantel abnehmen
Remova o revestimento
剥下护皮

4

1

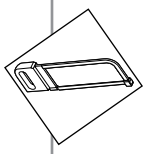

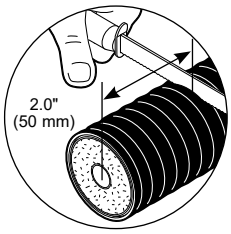

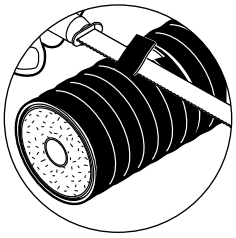

Remove jacket
Retire la envolvente
Retirez la gaine
Mantel abnehmen
Remova o revestimento
剥下护皮

2

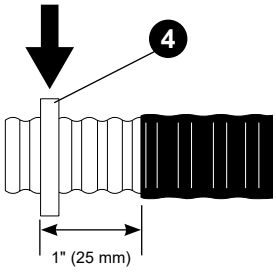

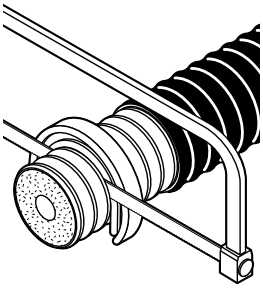

4

4

Deburr

Quitar las virutas

Ebavurez

Entgraten

Tirar as rebarbas

Sbavare

去毛刺

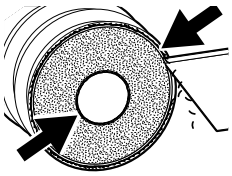

Inside edge, inner conductor
Borde interior, conductor interno
Bord interne, conducteur intérieur
Innenkante, Innenleiter
Borda interna, condutor interno
Bordo interno, conduttore interno
内缘，内导体

Inside edge, outer conductor
Borde interior, conductor externo
Bord interne, conducteur extérieur.
Innenkante, Außenleiter
Borda interna, condutor externo
Bordo interno, conduttore esterno
内缘，外导体

Outside edge, outer conductor
Borde exterior, conductor externo
Bord externe, conducteur extérieur
Außenkante, Außenleiter
Borda externa, condutor externo
Bordo esterno, conduttore esterno
外缘，外导体

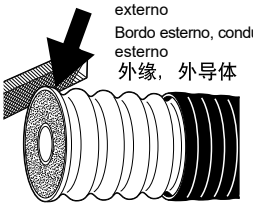

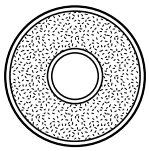

Be sure outer conductor is round and undistorted

Asegúrese de que el conductor externo es circular y no está deformado

Vérifiez si le conducteur extérieur a conservé sa forme ronde, sans distorsion

Außenleiter muss rund und nicht verformt seinVerifique se o condutor externo está redondo e se não está deformado

Verificare che il conduttore esterno sia tondo e non deformato

外导体必须呈圆形，且没有变形

5

Remove debris.

Retirar los restos.

Enlevez les d é bris.

Metallsp☒ne entfernen.

Remova os detritos.

去除殘渣

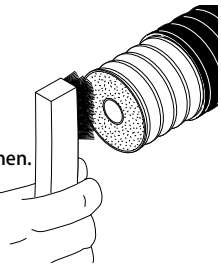

6

Add clamping nut.

A☒adir la tuerca sujeta dora.

Mettez en place l′ é crou de serrage.

Klemmutter montieren.

加緊固螺母Acrescente a porca de aperto.

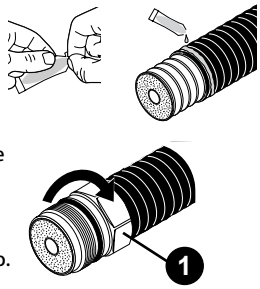

7

Add spring ring.

A☒adir el anillo el á stico

Mettez en place la bague ressort.

Federring montieren.

Acrescente o anel de mola.

加彈簧圈

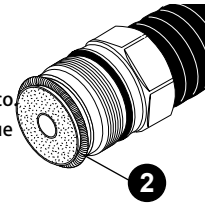

8

Compress foam.

Comprimir el material de espuma.

Comprimez la mousse

Versch☒umung zusammendr ü cken.

Comprima a espuma.

壓緊泡沫塑

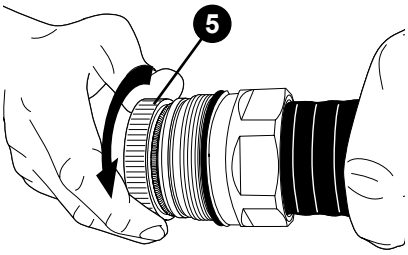

1/8" (3 mm) minimum
Mínimo 1/8" (3 mm)
1/8" (3 mm) minimum
Mind.1/8" (3 mm)
Mínimo de 1/8" (3 mm)
Minimo 1/8" (3 mm)

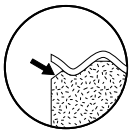

9

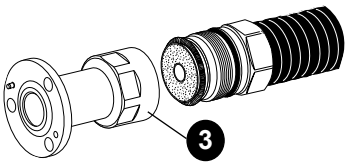

Attach connector to body.

Añadir el cuerpo del conector.

Fixez le corp du connecteur.

Steckergehäuse befestigen.

Coloque o corpo do conector.

清理毛刺和碎屑

10

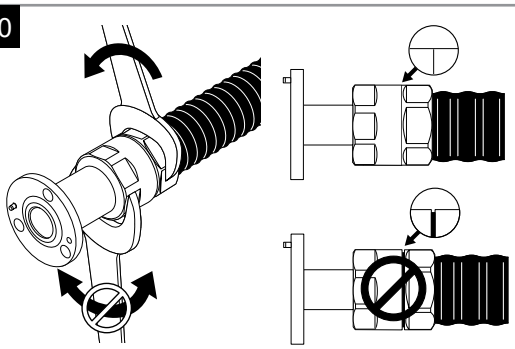

	表一 有毒有害物质或元素名称及含量标识格式					
	有毒有害物质或元素					
部件名称 (Part Name)	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr6+)	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
連接器 (Connector)	X	O	O	O	O	O

O: 表示有毒有害物质在该部件所有的均质材料中的含量均在SJ/T 11363-2006规定的限量要求以下.
X: 表示该有毒有害物质至少在该部件的某一均质材料中的含量超出SJ/T 11363-2006规定的限量要求.

ANDREW an Amphenol company
2601 Telecom Parkway, Richardson, Texas, 75082, USA
www.andrew.com

Technical Support
+1 888 297 6433, Option 3 (Toll Free US and Canada)
awpnarsupport@andrew.com

Notice: ANDREW disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices.
Aviso: ANDREW no acepta ninguna obligación ni responsabilidad como resultado de prácticas incorrectas o peligrosas de instalación, inspección, mantenimiento o retiro.
Avis : ANDREW décline toute responsabilité pour les conséquences de procédures d'installation, d'inspection, d'entretien ou de retrait incorrectes ou dangereuses.
Hinweis: ANDREW lehnt jede Haftung oder Verantwortung für Schäden ab, die aufgrund unsachgemäßer Installation, Überprüfung, Wartung oder Demontage auftreten.
Atenção: A ANDREW abdica do direito de toda responsabilidade pelos resultados de práticas inadequadas e sem segurança de instalação, inspeção, manutenção ou remoção.
Avvertenza: ANDREW declina eventuali responsabilità derivanti dell'esecuzione di procedure di installazione, ispezione, manutenzione e smontaggio improprie o poco sicure.
注意：ANDREW 公司申明對於不恰當或不安全的安裝、檢驗、維修或拆卸操作所導致的后果不負任 何義務和責任

©2025 ANDREW, an Amphenol company. All rights reserved. Amphenol and ANDREW are registered trademarks of Amphenol and/or its affiliates in the U.S. and other countries. All product names, trademarks and registered trademarks are property of their respective owners.

Millimeters 20 30 40 50 60 70 80 90 100 Inches 1 2 3 4