

## BH-Series Single and Double Block Hangers for Fiber, Power, Hybrid and Coaxial Assemblies


Bulletin 7717392 Revision F Page 1 of 1

### Description

BH-series Blocks are designed to secure multiple runs of cable in bundled space saving configurations. Blocks can be mounted directly to existing tower members using single, double, triple, or quadruple stack hardware kits recommended at 3ft (0.9m) intervals. For additional details on spacing, you can reference the ANDREW Hanger Spacing Guidelines.

[www.andrew.com/globalassets/digizuite/968475-7719798.pdf](http://www.andrew.com/globalassets/digizuite/968475-7719798.pdf)

| Block Part No.    | Compatible Cable Diameter Range | 1-Stack Hardware Part No.       | 2-Stack Hardware Part No.     | 3-Stack Hardware Part No.      | 4-Stack Hardware Part No.       |
|-------------------|---------------------------------|---------------------------------|-------------------------------|--------------------------------|---------------------------------|
| BHD-4MM           | 5-7 mm                          | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-14            | 7-9 mm                          | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-38            | 10-12 mm                        | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-58            | 17.8-20.1 mm                    | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-12S           | 13.5-15.5 mm                    | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-12            | 15.2-16.3 mm                    | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-78            | 27.7-28.2 mm                    | 3/8" 243095-9<br>M10 243095-11  | 3/8" 243095-5<br>M10 243095-7 | 3/8" 243095-1<br>M10 243095-3  | 3/8" 243095-2<br>M10 243095-4   |
| BHD-114 / BHS-114 | 39.6-40.6 mm                    | 3/8" 243095-10<br>M10 243095-12 | 3/8" 243095-6<br>M10 243095-8 | 3/8" 243095-2<br>M10 243095-37 | 3/8" 243095-38<br>M10 243095-37 |
| BHD-158 / BHS-158 | 49-51.1 mm                      | 3/8" 243095-10<br>M10 243095-12 | 3/8" 243095-6<br>M10 243095-8 | 3/8" 243095-2<br>M10 243095-37 | 3/8" 243095-38<br>M10 243095-37 |

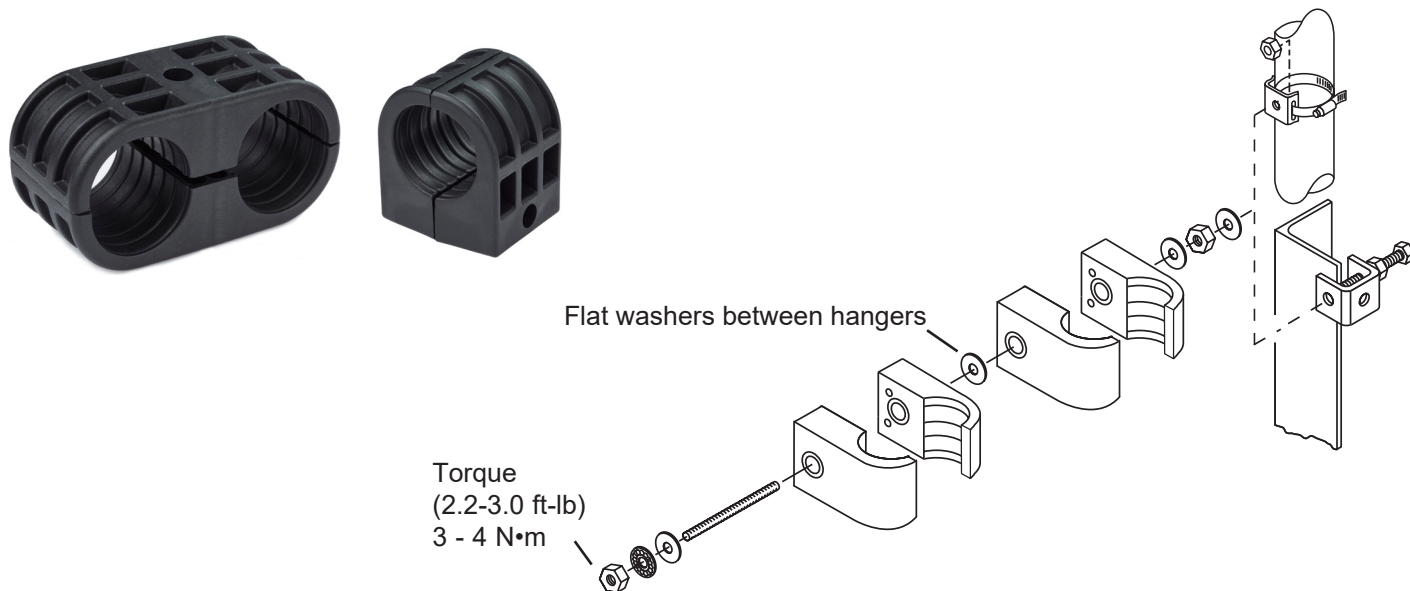

#### ANDREW an Amphenol company

2601 Telecom Parkway, Richardson, Texas, 75082, USA  
www.andrew.com

#### Technical Support

+1 888 297 6433, Option 3 (Toll Free US and Canada)  
awpnarsupport@andrew.com

Notice: ANDREW disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices.

Aviso: ANDREW no acepta ninguna obligación ni responsabilidad como resultado de prácticas incorrectas o peligrosas de instalación, inspección, mantenimiento o retiro.

Avis: ANDREW décline toute responsabilité pour les conséquences de procédures d'installation, d'inspection, d'entretien ou de retrait incorrectes ou dangereuses.

Hinweis: ANDREW lehnt jede Haftung oder Verantwortung für Schäden ab, die aufgrund unsachgemäßer Installation, Überprüfung, Wartung oder Demontage auftreten.

Atenção: A ANDREW abdica do direito de toda responsabilidade pelos resultados de práticas inadequadas e sem segurança de instalação, inspeção, manutenção ou remoção.

Avvertenza: ANDREW declina eventuali responsabilità derivanti dall'esecuzione di procedure di installazione, ispezione, manutenzione e smontaggio improprie o poco sicure.

注意: ANDREW 公司申明對於不恰當或不安全的安裝、檢驗、維修或拆卸操作所導致的後果不負責任 何義務和責任