


CPT and EZPT Tool Cleaning Instructions

Bulletin 7770684 Rev. B | Page 1 of 2

1

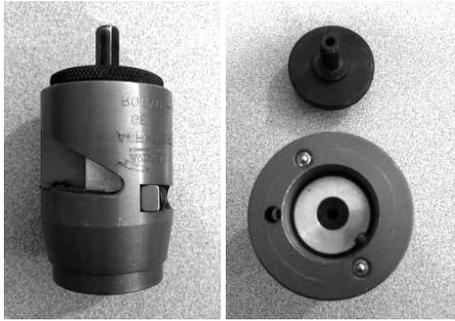


Remove flaring tool.

2



Remove the 6-32" button head screw holding the flat outer conductor blade in place. Insert the 5/64" hex key through the small hole in the top of the tool under the flaring tool. Debris should fall from the tool. If needed, pick, shake, or use compressed air to remove any adhering debris.

3

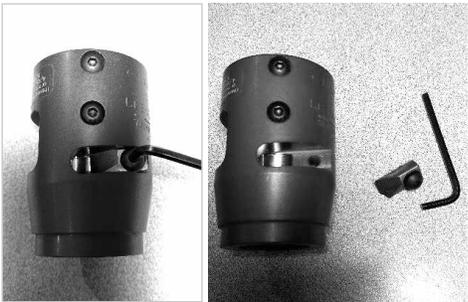


Remove the jacket stripping blade using the 1/8" hex key. Debris should fall from the tool. If needed, pick, shake, or use compressed air to remove any adhering debris.


4



Remove the two 1/8" button head screws on the side of the tool with the supplied 1/8" hex key.




5

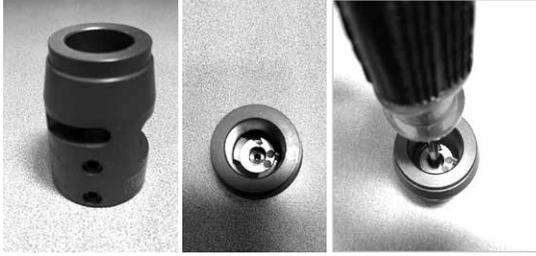

With the back of the tool on a flat surface, push the coring blade assembly from the tool using a Philips screw driver placed in the center hole of the tool. Do not hit or press on the edge of the coring blade. All force should be applied to the center of the assembly only.

6

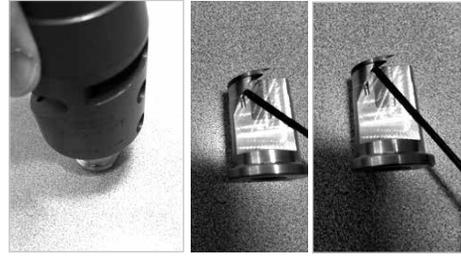

Once the assembly has been removed from the housing, most of the debris will fall from the tool. Using the supplied hex key, drag the hex key along the underside of the blade in the direction of the blade and any excess material will pull away from the blade. If needed, pick, shake, or use compressed air to remove any adhering debris from the blade or tool body. Reassemble blades in the reverse order shown. **CAUTION! Do not over-tighten screws.**

ANDREW an Amphenol company

2601 Telecom Parkway, Richardson, Texas, 75082, USA
www.andrew.com

Notice: ANDREW disclaims any liability or responsibility for the results of improper or unsafe installation, inspection, maintenance, or removal practices.
 Aviso: ANDREW no acepta ninguna obligación ni responsabilidad como resultado de prácticas incorrectas o peligrosas de instalación, inspección, mantenimiento o retiro.
 Avis: ANDREW décline toute responsabilité pour les conséquences de procédures d'installation, d'inspection, d'entretien ou de retrait incorrectes ou dangereuses.
 Hinweis: ANDREW lehnt jede Haftung oder Verantwortung für Schäden ab, die aufgrund unsachgemäßer Installation, Überprüfung, Wartung oder Demontage auftreten.
 Atenção: A ANDREW abdica do direito de toda responsabilidade pelos resultados de práticas inadequadas e sem segurança de instalação, inspeção, manutenção ou remoção.
 Avvertenza: ANDREW declina eventuali responsabilità derivanti dall'esecuzione di procedure di installazione, ispezione, manutenzione e smontaggio improprie o poco sicure.
 注意: ANDREW 公司申明對於不恰當或不安全的安裝、檢驗、維修或拆卸操作所導致的後果不負任何義務和責任

Technical Support

+1 888 297 6433, Option 3 (Toll Free US and Canada)
awpnarsupport@andrew.com